## **Technical Service Bulletin**

TSB-160317-1



## **Purpose**

 It has been determined that the some HISUN units are having brake issues, ie. Front/rear brakes locking up, brake lines blowing out at crimps and caliper seals, etc.

#### **Unit Affected**

 2015 HISUN UTV units affected SECTOR/STRIKE 250, SECTOR/STRIKE 1000, SECTOR/VECTOR 500-750 models.

## **Changes**

N/A

# Warranty claim Information and Process

- All normal warranty procedures apply.
- Refer to TSB-160317-1 on warranty claim.
- Expected service time paid is 0.2hrs.
- No special tools are needed to complete this service.
- Email <u>techsupport@hisunmotors.com</u> or call 888-405-8725 for additional information.

### None







**Required Dealer Action** 

### **Part Items**


TSB160317-1 Page **1** of **2** 

## **Technical Service Bulletin**

TSB-160317-1



- 1. Remove cotter pin and connecting pin from brake pedal.
- 2. Remove connecting pin assy.
- 3. Loosen the jam nut and adjust accordingly.
- 4. Reinstall and check for proper free play (1/4"-1/2") #2 image below

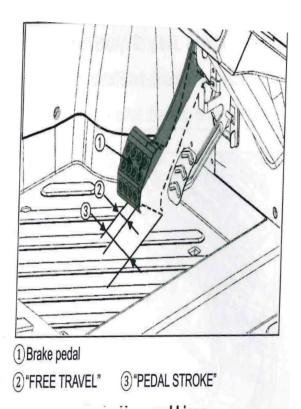

TSB160317-1 Page **2** of **2**